



Applies To: **2005 Accord Hybrid** – ALL
2006 Accord Hybrid – From VIN JHMCN3...6C000001 thru JHMCN3...6C002043

January 26, 2007

IMA Indicator Is On With DTC P0A7F

SYMPTOM

The IMA indicator comes on with DTC P0A7F (battery module deterioration).

PROBABLE CAUSE

Cold weather causes the IMA system to incorrectly set DTC P0A7F.

CORRECTIVE ACTION

Update the IMA battery software with the HDS.

WARRANTY CLAIM INFORMATION

In warranty: The normal warranty applies.

Operation Number: 723507

Flat Rate Time: 0.3 hour

Failed Part: P/N 1K000-RCJ-A04
H/C 8025579

Defect Code: 07201

Symptom Code: 03203

Template ID: 07-003A

Skill Level: Repair Technician

Out of warranty: Any repair performed after warranty expiration may be eligible for goodwill consideration by the District Parts and Service Manager or your Zone Office. You must request consideration, and get a decision, before starting work.

SOFTWARE INFORMATION

HDS Software Version: 2.006.012 or later.

NOTE: If you do not use the correct HDS software version, the HDS may incorrectly indicate that the vehicle does not need an update.

Listed below are the updated IMA battery software program IDs and P/Ns for each model year. If these program IDs or P/Ns are displayed during the update, the latest software is already installed.

Model Year	Program ID	P/N
2005 Accord Hybrid	RCJ3050	1K101-RCJ-305
2006 Accord Hybrid	RCJA070	1K101-RCJ-A07

REPAIR PROCEDURE

Update the IMA software with the HDS and HDS software version 2.006.012 or later. Refer to **UPDATING A CONTROL UNIT/MODULE WITH THE HDS** in Service Bulletin 01-023, *Updating Control Units/Modules*.

NOTE: If DTC P0A7F recurs after you update the IMA battery software, replace the IMA battery.